# Battery Status Report

SOH Blitz Test


## Vehicle Information

2020/Peugeot/2008
Odometer Reading: 62151.6km
VIN: VR3UKZKXZLJ558312
Rated Voltage: 377 V
Rated Capacity: 143.2 Ah

Test Time: 2026-09-17 01:58:42
Testing Organization:
Customer:
S/N: DR8GS9V03301
Version: V3.40


## Battery Status

### Pack Information

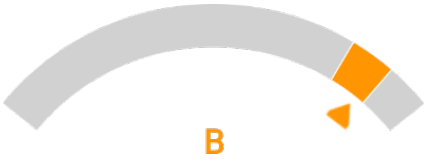



Battery Health Status

| | |
|---|---|
| SOH*: | 88 % |
| SOC: | 48 % |

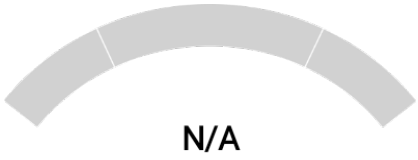


Static Temperature Consistency

| | |
|---|---|
| Battery Temperature: | N/A |
| Max Temperature Delta: | N/A |

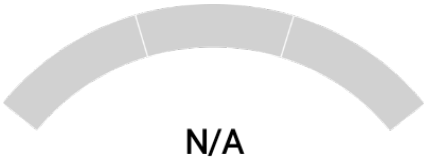


Static Voltage Consistency

| | |
|---|---|
| Battery Voltage: | 395.60 V |
| Max Voltage Delta: | 13 mV |




*: Based on the BMS data or related data of the vehicle manufacturer. Autel provides no guarantee regarding the actual SOH or physical condition of the battery.

### Battery DTCs

No fault codes detected

## Test Parameters

### Module Voltage Information

| | | | |
|---|---|---|---|
| Maximum Module Voltage: | **22.01 V** | Minimum Module Voltage: | **21.98 V** |
| Average Module Voltage: | **21.99 V** | Module Voltage Delta: | **0.03 V** |
| Standard Module Voltage Delta: | **0.01 V** | | |
| Maximum Cell Voltage: | **3.669 V** | Minimum Cell Voltage: | **3.656 V** |
| Average Cell Voltage: | **3.665 V** | Cell Voltage Delta: | **13 mV** |
| Standard Cell Voltage Delta: | **2 mV** | | |

Low High Warning Not OK

| Module | | Cell | | | | | | | |
|---|---|---|---|---|---|---|---|---|---|
| | | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 |
| M1 (#1-#6) | 21.98 V | 3.665 V | 3.665 V | 3.663 V | 3.663 V | 3.664 V | 3.662 V | | |
| M2 (#7-#12) | 21.99 V | 3.664 V | 3.664 V | 3.663 V | 3.666 V | 3.665 V | 3.664 V | | |
| M3 (#13-#18) | 21.98 V | 3.663 V | 3.664 V | 3.665 V | 3.665 V | 3.664 V | 3.663 V | | |
| M4 (#19-#24) | 21.98 V | 3.663 V | 3.665 V | 3.664 V | 3.662 V | 3.665 V | 3.663 V | | |
| M5 (#25-#30) | 21.99 V | 3.665 V | 3.663 V | 3.665 V | 3.665 V | 3.665 V | 3.663 V | | |
| M6 (#31-#36) | 21.98 V | 3.665 V | 3.664 V | 3.663 V | 3.664 V | 3.664 V | 3.663 V | | |
| M7 (#37-#42) | 21.98 V | 3.661 V | 3.663 V | 3.663 V | 3.664 V | 3.664 V | 3.663 V | | |
| M8 (#43-#48) | 21.98 V | 3.664 V | 3.664 V | 3.661 V | 3.666 V | 3.665 V | 3.664 V | | |
| M9 (#49-#54) | 22.01 V | 3.668 V | 3.666 V | 3.668 V | 3.668 V | 3.668 V | 3.669 V | | |
| M10 (#55-#60) | 22.01 V | 3.667 V | 3.669 V | 3.667 V | 3.669 V | 3.669 V | 3.666 V | | |
| M11 (#61-#66) | 21.99 V | 3.664 V | 3.665 V | 3.665 V | 3.665 V | 3.665 V | 3.665 V | | |
| M12 (#67-#72) | 21.98 V | 3.666 V | 3.663 V | 3.666 V | 3.666 V | 3.665 V | 3.657 V | | |
| M13 (#73-#78) | 21.99 V | 3.666 V | 3.665 V | 3.665 V | 3.664 V | 3.663 V | 3.665 V | | |
| M14 (#79-#84) | 21.99 V | 3.665 V | 3.664 V | 3.665 V | 3.666 V | 3.665 V | 3.665 V | | |
| M15 (#85-#90) | 21.99 V | 3.664 V | 3.667 V | 3.665 V | 3.665 V | 3.665 V | 3.665 V | | |

| | | | | | | | | | |
|---|---|---|---|---|---|---|---|---|---|
| M16 (#91-#96) | 21.98 V | 3.656 V | 3.666 V | 3.665 V | 3.665 V | 3.665 V | 3.663 V | | |
| M17 (#97-#102) | 21.99 V | 3.666 V | 3.666 V | 3.665 V | 3.665 V | 3.666 V | 3.663 V | | |

Testing Organization: _____

Address: _____

Tel: _____

Email: _____

Technician: _____

Date: _____

Note: Please save a copy of this report for your records.

*Disclaimer:*
*1. All data presented in this report are sourced from the original BMS data of the vehicle manufacturer or related derivative data. Due to factors such as delayed data updates or transmission latency, the report data may differ from the actual condition of the battery.*
*2. The results generated by this feature and its corresponding analysis strategy are for reference only. Autel makes no warranties regarding the authenticity, accuracy, or completeness of the data, and provides no guarantee, whether express or implied, regarding the actual SOH or physical health status of the battery. By using this feature, you are deemed to have agreed to and accept all terms of this disclaimer.*
*3. This report provides a reference for vehicle inspection and maintenance only. Autel is not liable for any accident, property damage, or personal injury resulting from the use of this information.*